L. Roberto Lomas P.E.

Engineering Evaluation Report

400 S Palm Ave Indialantic, FL 32903 434-688-0609 rllomas@lrlomaspe.com

Report No.: 514280B

Manufacturer: US Aluminum

950 Solon Rd.

Waxahachie, TX 75165

Product Line: D900 Out-Swing Hinged Door – Accessible Threshold w/Standard or 10" bottom rail, Small Missile

Impac

Compliance:

The product listed herein complies with requirements of the current Florida Building Code.

Supporting Technical Documentation:

 Approval document: drawing number 08-03297 Revision B, prepared, signed and sealed by Luis Roberto Lomas P.F.

2. Test report No.: I0495.01-303-18 R1 signed and sealed by Tyler Westerling P.E.

Intertek, Lake Forest, CA.

TAS 201/TAS 203 Small Missile Impact Test, Level A, Wind Zone 4

Cyclic Pressure loading ±80.0psf design pressure

TAS 202 Uniform Static Air Pressure, ±80.0psf design pressure, 15.04psf water penetration.

3. Test report No.: I9229.01-303-18 R0 (accessible threshold) signed and sealed by Tyler Westerling P.E.

Intertek, Lake Forest, CA.

TAS 201/TAS 203 Small Missile Impact Test, Level A, Wind Zone 4

Cyclic Pressure loading ±80.0psf design pressure

4. Test report No.: I9228.01-303-18 R1 (accessible threshold with 10" bottom rail) signed and sealed by

Tyler Westerling P.E. Intertek, Lake Forest, CA.

TAS 201/TAS 203 Large Missile Impact Test, Level D, Wind Zone 4

Cyclic Pressure loading ±80.0psf design pressure

TAS 202 Uniform Static Air Pressure, ±80.0psf design pressure, 15.04psf water penetration.

5. Anchor calculations, report number 514280-1B, prepared, signed and sealed by Luis Roberto Lomas P.E.

Limitations and Conditions of use:

Design pressure: ±80.0psfUnit size: ±80.0psf


- Units must be glazed per ASTM E1300, according to glazing details in approval drawing.
- This product is rated to be used in the HVHZ.
- This product is impact resistant and does not require impact protection in wind borne debris regions, when installed 30ft or more above ground level.
- Frame material to be Extruded Aluminum 6063-T5.

Installation:

Units must be installed in accordance with manufacturer's installation instructions and approval document 08-03297, Revision B.

Certification of Independence:

Please note that I don't have nor will acquire a financial interest in any company manufacturing or distributing the product(s) for which this report is being issued. Also, I don't have nor will acquire a financial interest in any other entity involved in the approval process of the listed product(s).

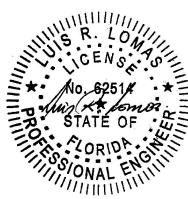

Luis R. Lomas, P.E. FL No.: 62514 04/04/2023